

solenoid nut - tightened and snapped

THIS MAY CAUSE THE WARRANTY TO BE VOID




DON'T

OVER TIGHTEN THE SOLENOID NUT

Over Tightening: Excessive torqueing of fasteners can break posts or other vital components on or inside the solenoid.

(Standard Torque Recom : Energising Terminal 4-6nm, B+ 11-14nm)

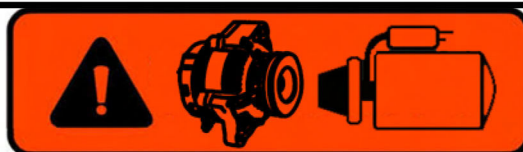

For information on any specific replacement unit please call our technical department.

Rolling Components Ltd

Tel: +44 1268 271035 Fax: +44 1268 527334

www.rollingcomponents.com